

Institut für Energie- und
Umwelttechnik e.V. (IUTA)

Air Quality & Filtration
Bliersheimer Straße 58 – 60
47229 Duisburg
Germany



- IUTA-CERTIFICATE -

Validation of compressed air filters in accordance to ISO 12500-1:2007

(Filters for compressed air – Test methods – Oil aerosols)

Customer: ETHAFILTER s.r.l., Via dell'Artigianato, 16/18, I-36050 Sovizzo (Vicenza),
Italia
Tested product: **Model EAL 1308 SMA**
IUTA test report: LrF 89/13
Tested cartridge: Threefold measurement of three cartridges model EAL 1308 SMA

Test parameters Inlet pressure Air flow Test inlet oil concentration Compressor oil viscosity	7 bar (e) [8 bar (a)] 30 Nm ³ /h = 100 % nominal flow rate 10 ± 2 mg/m ³ ISO VG 46			
Test results	Cartridge 1	Cartridge 2	Cartridge 4	Average
Dry pressure drop * (mbar)	55	55	61	57
Saturated pressure drop	201	167	175	181
Mean outlet oil concentration [mg/m³ (ANR)]**	0.013 ± 0.001	0.010 ± 0.001	0.012 ± 0.002	0.012 ± 0.002
Filtration efficiency (The calculation is based on the data shown in the test report)				99.88 %


* Pressure drop measured on the top of the filter-housing model NEA 108 SMA

** Mean outlet oil concentration of each of three cartridges is determined by averaging the results of a threefold measurement on each cartridge (nine measurements in total) and finally the total average is shown.

Duisburg, 18th December 2013



Managing Director

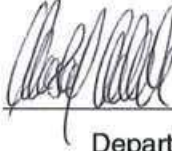

Department Head

Vorstand:
Prof. Dr.-Ing. Dieter Bathen
Dr.-Ing. Stefan Haep
Dipl.-Ing. Jochen Schiemann
Dipl.-Volksw. G. Schöppe

Wissenschaftlicher Leiter vertretungsberechtigt gemäß § 26 BGB
Vorstandsvorsitzender und Geschäftsführer
Stellvertretender Vorstandsvorsitzender und Geschäftsführer
Geschäftsführer

Bankverbindung
National-Bank Duisburg
Kto.-Nr. 541 524
BLZ 360 200 30

ID-Ust-Nr. VAT-DE 121 321 445
Vereinsregister VR 2872, Duisburg
Ust.-Nr. 134-5743-0340
SWIFT-Code NBAGDE3E
IBAN DE 90360200300000541524

Bekanntgegebene Meßstelle für
Messungen/Untersuchungen nach:
§§ 26, 28 BImSchG
Zertifizierter Entsorgungsbetrieb
Zugelassene Prüfstelle im Sinne
TA Luft 5.4.8.10.3, 5.4.8.11.3